


SecureSync 2400

Software Version 1.12.0: Release Notes

Safran Trusted 4D (Orolia/ Spectracom) released a software update for SecureSync 2400 model. Customers can download this software update at no charge from the Safran Trusted 4D website (see [Downloading the Software Update](#)). This software update will upgrade the unit's system software to **Version 1.12.0**.

This update provides added benefits through new features, enhancements to existing functionality, as well as software fixes and security updates, as described in this document.

Note: if your unit is currently on a software version below 1.4.1, it is necessary to upgrade to 1.4.1 before proceeding further (see image below). The upgrade to 1.4.1 includes significant system changes and does not allow downgrading to earlier versions. Refer to the upgrade warnings section of the 1.4.1 release notes in this document for specific information.

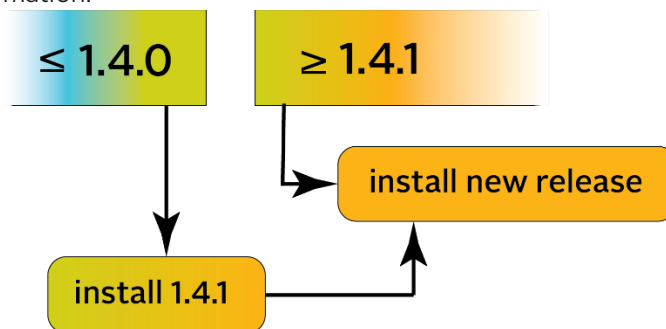

For your convenience, older legacy releases are also described in this document.

Table of Contents

Table of Contents.....	2
Version 1.12.0	3
Version 1.11.0	5
Version 1.8.0.....	8
Version 1.7.0.....	11
Version 1.6.0.....	14
Version 1.4.3.....	17
Version 1.4.1.....	18
Version 1.3.0.....	21
Version 1.2.2	23
Version 1.2.1.....	24
Version 1.2.0.....	25
Version 1.1.0a	27
Version 1.0.2.....	28
Which SW version is installed on my SecureSync?.....	29
How to download and install the new SW	30
How to contact Safran Technical Support	31

Version 1.12.0

Note:

The SecureSync Web UI will no longer support Internet Explorer, due to Microsoft no longer supporting the product and the limitations of the age of the browser.

Newly released features

- Added 5MPPS/1PPS composite clock preset for 1204-17 card; also added this preset for GPO interfaces on the 15-pin connector.
- Added support for the 4 x 10 Gb WROX card (1204-59) (Note: this card is also supported on software version 1.11.0).
- Added `speedget` and `speedset` CLI commands in order to force a network interface to operate at a set specific rate or duplex instead of auto-negotiating.
- Added support for new digest schemes for NTP symmetric key generation: SHA256, SHA512, SHA3-256, and AES128MAC.

Enhancements and fixes

The following improvements were applied to existing features and functions:

- PTP slave nodes can now synchronize to Masters with the clock class 248.
- Altered file upload locations; when upgrade files are uploaded via the Web UI, the file will be located in `/var/lib/spui`, and files uploaded via the cli will remain in `/home/spectracom/`.
- Updated NMEA over UDP input status field reporting to include distinction between (1) “first priority reference is enabled and valid” and (2) “first priority reference is disabled or invalid and at least one other reference is enabled and valid”.
- Added functionality to delete the publicly documented `spadmin` account, provided at least one admin-level account exists on the system.
- A new Safran-themed loading animation is now present on the Web UI.
- GSPD Web UI receiver status calls now display a list of active satellites.
- Added journal entries for removing `tcpdump`, when adding or deleting the `spfactory` account, and for SSH idle timeout configuration changes.
- It is now possible to edit a user to change the assigned group (user, admin, etc.).

The following defects were corrected:

- All temperature reports are now displaying on the Web UI at one 10th of a degree.
- Fixed a Web UI error on the System Status panel; when using NTP1 reference the system no longer reports “none”.
- Fixed error in which NTP Throughput graph data was not available for download in the Web UI.
- Corrected a problem with the system caching deleted usernames so that they cannot be reused.
- Fixed an issue wherein the Restore Factory Default command did not remove password history.
- Fixed problem with custom login banner not resetting after Restore Factory Default.
- Removed settings cache when deleting PTP slave and masters via the Web UI.
- Clear logs and stats button on the Web UI now also deletes GNSS and Oscillator graph data.
- Corrected Output LED behavior when all outputs are set to “disabled in Holdover” and unit is in sync.
- Corrected the origin of the temperature reading of Rubidium units.
- Fixed a bug when setting up email relay accounts in expert mode that caused CTRL + M characters added to each line, causing SMTP to fail.

Security enhancements and fixes

- Removed DNSSEC access as it is not supported in our system.
- Limited access to system by enabling CONFIG_SECURITY_DMESG_RESTRICT and removing user access to `dmesg`.
- Limited access to enable or disable AGNSS server to users with admin privileges.
- When configuring TACACS+ and RADIUS and entering the secret key in a password field as plain text, it is automatically hidden.

Option Card enhancements and fixes

- N/A.

REST API enhancements and fixes

The latest REST API documentation (revision 7) for this release contains the following changes:

- Added new endpoints
 - N/A.
- Changes to existing endpoints
 - REST_API_Network -> Get Interface Configuration - updated REST API response (and doc examples) to remove deprecated, misspelled `EthernertPort` field; replaced by `EthernetPort`.
 - REST_API_Network -> Configure Interface - updated request and response (and doc examples) to remove deprecated, misspelled `EthernertPort` field; replaced by `EthernetPort`.
 - REST_API_HOME -> `systemStatus` removed erroneous newline character from this request's `Alarm` field entries when the system has active alarms.
- Updated documentation
 - Updated REST_API_NTP -> Get Peers Status example response to show the status of GPS-timed NTP peer.
 - Updated REST_API_PTP -> Clear Configuration doc to add an example request and response for clearing configuration and disabling PTP ports.

Known Issues

- Option cards 1204-49 and 1204-4A are limited to install on slots 1 & 2 only.
- This software version DOES NOT ALLOW downgrades before version 1.4.1.
- PTP over a VLAN interface can only be configured through the CLI (see an app note (from 1.4.1)).
- PTP Power Profile (IEEE C37.238) is unable to pass the Alternate Time Offset Indicator and Total Time Inaccuracy TLVs through the system when PTP interfaces are configured as both a master and a slave (from 1.4.1).
- Changing the system timescale will require PTP to be manually restarted (from 1.6.0).
- Telecom Quality Level clock classes are not supported for G.8265.1 PTP masters (from 1.7.0).
- GNSS receiver constellation configuration changes may intermittently fail to succeed. Customers are advised to confirm constellation selections and retry the operation if the changes were not successful (from 1.7.0).
- SNMP V1 may not function correctly if a SNMP V2c server is also configured on the unit (from 1.8.0).
- PTP monitoring graphs on the Web UI are temporarily disabled to improve throughput performance at high request-per-second rates (from 1.12.0).

Version 1.11.0

Note:

The SecureSync Web UI will no longer support Internet Explorer, due to Microsoft no longer supporting the product and the limitations of the age of the browser.

Newly released features

- Redesigned the Web UI appearance to use Safran colors and UI design. All organization and controls are in the same location.
- Improvements to the PTP page of the Web UI: added a new Port Monitor graph, two graphs to demonstrate the Offset and Path Delay of PTP Slave Ports, and added a new *last* figure to the PTP Statistics, which is the length of time a particular message type was last received.
- Added the option to configure 12-hour or 24-hour time on the front panel display. This feature can be configured via the front panel, the Web UI, or the CLI.
- Added support in the Web UI for multiple PTP Unicast masters for a configured slave port.
- Added AGNSS server support (can be configured via the Web UI, REST API, and CLI) for use with an OPT-AGP license.
- Added `gettemp board|cpu|osc` commands to obtain the temperature of different sensors in the system.
- Both Ethernet ports now have preset static IP addresses. If DHCP is disabled, the Ethernet ports will automatically be set to: Eth0: 192.168.1.1/24 and Eth1: 192.168.1.2/24.

Enhancements and fixes

The following improvements were applied to existing features and functions:

- Added support for NTP Anycast on VLAN interfaces.
- Custom configurations of iptables can now persist over reboot using `iptables-save` CLI command (the `iptables-restore` command will conversely return iptables to default settings).
- Improved time drift of Web UI display when minimized in a window.
- Updated HSTS Web UI configuration to improve user experience.
- Updated Web UI display for the Quick Align feature from Automatic Restart Tracking (One Time) to Always Restart Tracking After Sync.

The following defects were corrected:

- Fixed the Known Issue: *ASCII time code format ICD-153c is supported only on the -02 and -1F option cards, and only if the unit has a SAASM receiver installed. (from 1.3.0).* ASCII time code ICD-153c is now available on the main board interface.
- Fixed the Known Issue: The front panel lock and unlock CLI commands (`fplock` and `fpunlock`) are currently broken (from 1.8.0).
- Fixed an issue with the NMEA over UDP Input Status field.
- Corrected an “interface not activated” message when using the `net4` command if eth0 was not configured.
- Repaired `gpsdserviceportset` command in circumstances where port information changed.
- Fixed `ptpcfgload` command not loading new configuration properly.
- Corrected a problem on the front panel wherein the mask and ip address couldn’t be configured at the same time.

Security enhancements and fixes

- Updated several packages:

- Upgraded Apache from 2.4.57 to 2.4.58
- Upgraded JQuery version from 3.7.0 to 3.7.1
- Upgraded OpenSSL from 1.1.1u to 1.1.1w
- Upgraded PHP from 8.2.6 to 8.2.12
- SNMPv3 passphrases are now hidden via REST API.

Option Card enhancements and fixes

- Fixed an issue with detection of 1204-32 cards after reboot
- Fixed an issue with configuration of 1204-32 cards on boot.
- Fixed an error with the NTP Access Restrictions settings on the 1204-4A and 1204-49 cards.

REST API enhancements and fixes

The latest REST API documentation (revision 7) for this release contains the following changes:

- Added new endpoints
 - Added `REST_API_Features -> A-GNSS Server -> Get AGNSS Server Status` to see AGNSS server and data status when enabled and license installed.
 - Added `REST_API_Features -> A-GNSS Server -> Get AGNSS Server Settings` to see current AGNSS server configuration if license installed.
 - Added `REST_API_Features -> A-GNSS Server -> Set AGNSS Server Settings` to enable and set AGNSS server configuration if license installed.
- Changes to existing endpoints
 - `REST_API_Logs -> Get Specific Status Logs` now returns results for `LogPtpStats` for PTP port stats and `LogPtpSlaveStats` for PTP Slave stats when entered into `statusLog` variable.
 - `REST_API_Logs -> Clear Specific Status Logs` now clears `LogPtpStats` for PTP port stats and `LogPtpSlaveStats` for PTP Slave stats when entered into `statusLog` variable.
 - `REST_API_Network -> Interfaces -> Get Interface Configuration` updated to correct response's data structure misspelling of "Ethernert" by adding properly spelled section "Ethernet" and deprecating old.
 - `REST_API_Network -> Interfaces -> Configure Interface` updated to correct response's data structure misspelling of "Ethernert" by adding properly spelled section "Ethernet" and deprecating old.
 - `SecureSync 2400 -> REST_API_FrontPanel -> Get Front Panel Configuration` endpoint updated to return 12 or 24 for the ``clock-format`` field to indicate 12 or 24-hour time setting on front panel time display.
 - `SecureSync 2400 -> REST_API_FrontPanel -> Set Front Panel Configuration` endpoint updated to accept only 12 or 24 for the ``clock-format`` field to configure 12 or 24-hour time setting on front panel time display.
- Updated documentation
 - Updated `REST_API_PTP -> Get Settings` doc to include an example showing how to configure 1 or more unicast masters.
 - Updated `REST_API_PTP -> Set Settings` doc to include an example showing how to configure 1 or more unicast masters.
 - Updated `REST_API_SecurityIssues -> List Security Issues` doc to point to correct URL for Security Issues information.
 - Updated `REST_API_SecurityIssues -> Reset Security Issue` doc to point to correct URL in request and example.
 - Updated `REST_API_TimeManagement -> Delete Local Clock` doc to remove unnecessary body section in both request and example responses.

Known Issues

- Option cards 1204-49 and 1204-4A are limited to install on slots 1 & 2 only.
- This software version DOES NOT ALLOW downgrades before version 1.4.1.
- The clean command does not reset the GNSS position. It is recommended to unplug the receiver, reset the receiver in the Web UI, and then run the clean command to reset the GNSS position (from 1.3.0). The Sanitize functionality can also serve this purpose.
- PTP over a VLAN interface can only be configured through the CLI (see an app note (from 1.4.1).
- PTP Power Profile (IEEE C37.238) is unable to pass the Alternate Time Offset Indicator and Total Time Inaccuracy TLVs through the system when PTP interfaces are configured as both a master and a slave (from 1.4.1).
- The SFP fiber link-state on models AVAGO AFBR-5710PZ and FTLF8519P2BNL are not working properly (from 1.4.1).
- PTP Power Profile (IEEE C37.238) is only able to sync to an EdgeSync master when set to mixed Unicast mode (from 1.4.1).
- Changing the system timescale will require PTP to be manually restarted (from 1.6.0).
- Telecom Quality Level clock classes are not supported for G.8265.1 PTP masters (from 1.7.0).
- GNSS receiver constellation configuration changes may intermittently fail to succeed. Customers are advised to confirm constellation selections and retry the operation if the changes were not successful (from 1.7.0).
- SNMP V1 may not function correctly if a SNMP V2c server is also configured on the unit (from 1.8.0).

Version 1.8.0

Newly released features

- Redesigned the PTP Web UI page to include new configuration and data, including a datasets page, a back panel image, a drop-down panel with network information for both Slave and Master ports, and an updated PTP Statistics page.
- Added a PTP-specific tcpdump functionality on the Web UI PTP page.
- Updated Web UI back panel images to increase visibility and modularity.
- Updated Orolia-branded Web UI logos, MIBs and website links to reflect Safran Trusted 4D branding.
- Added PTP SNMP dataset retrieval and PTP base MIB.
- Added a new Download Logs & Configs Web UI feature in the Tools > Upgrade/Backup page that will bundle both logs and configuration data into one package for Technical Support.
- Added an Automatic Restart Tracking (OneTime) option to the disciplining configuration (MANAGEMENT > Disciplining) checkboxes. This feature allows the algorithm to make a large alignment leap (instead of small adjustments over time) to quickly align the oscillator to a significantly offset timing source.
- The SSH timeout setting is now user-configurable, rather than being hard-set to 60 minutes. To adjust your SSH timeout settings in the Web UI, navigate to MANAGEMENT > SSH Setup.

Enhancements and fixes

The following improvements were applied to existing features and functions:

- The `spfactory` account has some elevated privileges and is now deleted from the unit by default. In units upgrading from older software versions, `spfactory` will remain on the unit until deleted. The Security Issues panel will provide a notification if the `spfactory` account is still on your unit.
- Added Announce and Sync interval settings support for PTP unicast
- Added CLI configuration support for the `logAnnounceInterval` on a PTP slave using the `ptpifaceset` command.
- Reduced logging via PTP to only critical portion of reports.
- Corrected Web UI constellation selection to limit incompatible choices.
- Changed Web UI representation of tcpdump removal button from a toggle to a Remove button.
- Users are now redirected to the login page when logging out.

The following defects were corrected:

- Corrected a PTP SNMP resource usage issue.
- Fixed a problem with the oscillator disciplining Restart Tracking feature.
- Fixed an issue with the rollback feature.
- Altered PTP validity reporting to ensure PPS only displays as valid if the time is valid for the PTP reference.
- Corrected an error with certain Broadshield alarms triggering Hot Swap Power Supply alarms.
- Fixed the functionality to clear PTP statistics.
- Repaired the Network Access Control feature.
- Fixed a reporting problem in which SNMP did not reflect a hostname change.
- Fixed an error with NTP Access Restrictions with an IPv4 address containing "127".
- Corrected a `rsyslog.service` and `syslog.socket` crash caused by toggling local logging.
- Repaired a display issue with SNMP OID `ssSysUpdateFile` to support our new `squash.fs` upgrade format.
- Fixed a failure to create a new user via the CLI when RADIUS or TACACS+ are enabled.
- Fixed an error with PTP L2 E2E MAC address default.

- Fixed a problem with the rollback feature that prevented the unit from switching software partitions.
- Corrected an issue with duplicate users on the system preventing upgrade.
- Fixed a problem with the front panel OLED incorrectly displaying a mixed TIME/PPS reference in the inputs monitor.
- Repaired a bug wherein if a static IP address is configured via the CLI, it is not possible to enable DHCP via the front panel.
- Repaired an error wherein if DHCP was disabled from the front panel without a static address having already been configured, the system will delete the IPv6 address.

Security enhancements and fixes

- Updated several packages:
 - Updated the Linux kernel from 5.10.104 to 6.1.32
 - Upgraded Apache from 2.4.54 to 2.4.57
 - Upgraded OpenSSL from 1.1.1q to 1.1.1u
 - Upgraded NetSNMP from 5.9 to 5.9.3
 - Upgraded OpenSSH from 8.9p1 to 9.3p2
 - Upgraded PHP from 8.2.6 to 8.0.20
- Repaired [CVE-2023-4911](#) (called “Looney Tunables”) via a software patch to glibc.
- Repaired [CVE-2023-38408](#) via OpenSSH update.
- Repaired [CVE-2012-6708](#) via JavaScript update.
- Switched password storage from MD5 to SHA-512. Users with older-style encryption will be notified via the Security Issues panel to change their password in order to use the new encryption method.
- Added a Web UI Change Password dialog and Security Issues notification to prompt password updates.
- Increased Broadshield security to limit unwanted access to features.
- Corrected a problem with reboot auto-resolving the self-signed certificates Security Issue notification.
- Disabled X11 forwarding on the SSH configuration.
- Limited access to the Security Issues Web UI panel to admin users only.
- Added a new system recovery feature to recover units in distress.

Option Card enhancements and fixes

- Corrected a Clock Accuracy reporting problem with the 1204-32 card.
- Fixed an error with a 1204-49 and 1204-4A log spamming.
- Repaired Signature Control functionality in Stanag and HAVE QUICK cards (1204-25 and 1204-11).

REST API enhancements and fixes

The latest REST API documentation (version 6) for this release contains the following changes:

- Changes to existing endpoints
 - `del_pos` field no longer when editing GNSS Reference at `Features/edit/0000-0029-00.json` for Features -> Edit Feature
 - Authentication -> Edit User endpoint no longer returns error on success
 - Authentication -> Logout no longer returns 500 error when using while logged out.
 - `bgp_neighbor_as` and `bgp_as` in NTP -> Set Anycast Configuration endpoint now accept integer and string values
 - Can now edit individual entries in the Reference Priority table in References -> Configure References endpoint
- Updated documentation
 - Added documentation for the contacts page Tools -> Get Support Contact Link

- o Added documentation for manuals page `Tools -> Get Online Manuals Link`

Known Issues

- Option cards 1204-49 and 1204-4A are limited to install on slots 1 & 2 only.
- This software version DOES NOT ALLOW downgrades before version 1.4.1.
- ASCII time code format ICD-153c is supported only on the -02 and -1F option cards, and only if the unit has a SAASM receiver installed. This format is not supported on the main board interface (from 1.3.0).
- The clean command does not reset the GNSS position. It is recommended to unplug the receiver, reset the receiver in the Web UI, and then run the clean command to reset the GNSS position (from 1.3.0). The Sanitize functionality can also serve this purpose.
- PTP over a VLAN interface can only be configured through the CLI (see an app note (from 1.4.1).
- PTP Power Profile (IEEE C37.238) is unable to pass the Alternate Time Offset Indicator and Total Time Inaccuracy TLVs through the system when PTP interfaces are configured as both a master and a slave (from 1.4.1).
- The SFP fiber link-state on models AVAGO AFBR-5710PZ and FTLF8519P2BNL are not working properly (from 1.4.1).
- PTP Power Profile (IEEE C37.238) is only able to sync to an EdgeSync master when set to mixed Unicast mode (from 1.4.1).
- Changing the system timescale will require PTP to be manually restarted (from 1.6.0).
- Telecom Quality Level clock classes are not supported for G.8265.1 PTP masters (from 1.7.0).
- GNSS receiver constellation configuration changes may intermittently fail to succeed. Customers are advised to confirm constellation selections and retry the operation if the changes were not successful (from 1.7.0).
- The Web UI has significant performance issues with IE and an alternate browser may be necessary (from 1.8.0).
- SNMP V1 may not function correctly if a SNMP V2c server is also configured on the unit (from 1.8.0).
- The front panel lock and unlock CLI commands (`fplock` and `fpunlock`) are currently broken (from 1.8.0).

Version 1.7.0

Newly released features

- Increased password policy security, authentication constraints, and lockout responses.
- Corrected the Secure LDAP (LDAPS) path and filenames for security certificates functionality, made LDAPS the default setting, and added a warning message if LDAP is configured to not use the secure settings. Adjusted settings to match LDAP password permissions. Added a Disable Server Certificate Checks option to authenticate, if necessary, LDAPS without proper security certificates.
- Added support for default user groups to configure permission levels of RADIUS, TACACS+, and LDAP users.
- Added the SNMP variables `ssSysStaDisciplining`, `ssSysSetManualTime`, and `ssSysStaSyncState` to the unit MIB to query the disciplining state.

Enhancements and fixes

The following improvements were applied to existing features and functions:

- Added support for the DER file type for uploading HTTPS certificates.
- Repaired inconsistencies in the REST API variables and documentation.
- Added support for special characters “:” “;” and “-” to SNMP contact field.
- PTP status is now recorded in the daemon log.
- Expanded NTP Symmetric Key Strings to allow up to 40 hexadecimal characters. MD5 keys can optionally allow up to 20 ASCII characters instead.

The following defects were corrected:

- Corrected PTP slave functionality within the G.8265.1 profile to accept profile-specific clock classes.
- Fixed issue performing SNMP GET on the `sysSetManualTime` object.
- Corrected allowed constellation combination inconsistencies on the Web UI and CLI so that settings align with receiver capabilities.
- Repaired time jumps occurring on PTP masters when applying leap seconds.
- On multicast, a PTP master now properly enters passive mode when not best in domain.
- Added prompting error messages for incomplete Web UI fields on the NTP setup page.
- Fixed an issue with units not completing Sanitization state as expected.
- Repaired HAVE QUICK Input 0 (via the 15-pin multi-I/O) sync issue.
- Fixed loss of GNSS signal when changing constellations via the front panel information menu.
- Corrected Disciplining State Fault error message when GNSS is disabled on Low Phase Noise units.
- Fixed issue with the timing system to reduce errors during receiver configuration.
- Corrected an intermittent LDAP certificate upload path issue.

Security enhancements and fixes

- Web UI logins and logouts are now recorded in the Auth log.
- Changes to Web UI passwords or password policy are now recorded in the Journal log.
- Changes to LDAP, TACACS+, and RADIUS server configurations are now recorded in the journal log (sensitive data such as passwords are not logged directly, but the action of change is noted).
- Added security to Web UI to prevent cross-site scripting attacks.
- Increased login security for user enumeration attacks and bad user lockdowns.
- Repaired PKCS7 http certificate uploads in the `.der` and `.pem` file formats.
- The LDAP `bindpw` field is no longer automatically populated on the Web UI or in the REST API. Users are now required to reenter the password during configuration changes.

Option Card enhancements and fixes

- Upgraded option card versions:
 - 1204-19 to 1.03
 - 1204-21 to 1.02
 - 1204-2B to 1.02
- Fixed an issue on 1204-19, -21, and -2B cards where a PPS output the signal could persist if disabled during the span of the PPS pulse.
- Corrected 1204-0F card configuration errors

REST API enhancements and fixes

The latest REST API documentation (version 5) for this release contains the following changes:

- Added endpoints
 - Added Set Global TACACS+ Configuration endpoint with required variable `user_group` to configure user permission level.
- Changes to existing endpoints
 - LDAP `bindpw` field is no longer automatically populated on Get LDAP Settings and Set LDAP Settings responses.
- Added required variables
 - When adding a TACACS+ server in Add TACACS+ Server endpoint, the `button` variable is now required in the request body with the value `"add_tacacs_server"`.
 - Added required variable `user_group` to the Set Global RADIUS Configuration endpoint for user permission levels.
 - Added required variable `disable_cert_check` to Configure LDAP Settings endpoint to enable LDAP-S without a valid certificate.
 - Added required variable `user_group` to Configure LDAP Settings endpoint for user permission level.
- Updated documentation
 - Added documentation for Set Global RADIUS Configuration endpoint.
 - Corrected misspelling of URL in PTP collection's Set Settings endpoint.
 - Corrected inconsistencies in "success" field of response body for PTP collection's Restore Settings and Clear Statistics endpoints.
 - Changed collection to reflect validation correction for Get Symmetric Keys and Add Symmetric Key endpoints.
 - Added documentation for the Delete Interface IPv6 Address endpoint.
 - Corrected typos in field names in the request and response bodies for the Edit Symmetric Key endpoint.

Known Issues

- Option cards 1204-49 and 1204-4A are limited to install on slots 1 & 2 only.
- This software version DOES NOT ALLOW downgrades before version 1.4.1.
- ASCII time code format ICD-153c is supported only on the -02 and -1F option cards, and only if the unit has a SAASM receiver installed. This format is not supported on the main board interface (from 1.3.0).
- The clean command does not reset the GNSS position. It is recommended to unplug the receiver, reset the receiver in the Web UI, and then run the clean command to reset the GNSS position (from 1.3.0). The Sanitize functionality can also serve this purpose.
- PTP over a VLAN interface is not currently functional (from 1.4.1).
- PTP Power Profile (IEEE C37.238) is unable to pass the Alternate Time Offset Indicator and Total Time Inaccuracy TLVs through the system when PTP interfaces are configured as both a master and a slave (from 1.4.1).

- The SFP fiber link-state on models AVAGO AFBR-5710PZ and FTLF8519P2BNL are not working properly (from 1.4.1).
- PTP Power Profile (IEEE C37.238) is only able to sync to an EdgeSync master when set to mixed Unicast mode (from 1.4.1).
- Changing the system timescale will require PTP to be manually restarted (from 1.6.0).
- Telecom Quality Level clock classes are not supported for G.8265.1 PTP masters (from 1.7.0).
- GNSS receiver constellation configuration changes may intermittently fail to succeed. Customers are advised to confirm constellation selections and retry the operation if the changes were not successful (from 1.7.0).

Version 1.6.0

Newly released features

- Implemented a new Web UI Security Issues page and added warning messages related to common web security concerns (some of these warnings may arise after upgrade if conditions are present).
- Added full Sanitization support in the Web UI and CLI. Sanitizing the unit will remove all user-related data, location history, usage statistics, etc., rewrite both partitions with clean software, and return the unit to a state completely without user data. Full status reporting of the sanitization process is available through the serial connection.
- Added support for HSTS (HTTP Strict Transport Security).
- Enabled Broadshield SNMP traps for jamming and spoofing monitoring.
- Created new REST API documentation (found at <https://www.rolia.com/portal/public-downloads/rest-api-for-securesync-netclock-9400-and-versasync/>) to clearly outline endpoints for the user. This documentation is also available within the Web UI on the HELP page.
- Added detailed Hot Swap Power Supply (HSPS) monitoring features to the unit front panel, SNMP communications, the Web UI, and the CLI. HSPS monitoring can be disabled to limit alarming and communications about the state of a particular sled in a bay, if only one power supply is installed.
- Added NMEA-over-UDP functionality. For more information, see the App Note <https://www.rolia.com/document/nmea-over-udp/> . Note: multicast frames can only be sent on Eth0 (not Eth1).

Enhancements and fixes

The following improvements were applied to existing features and functions:

- Upgraded several packages:
 - Updated the Linux kernel to 5.10.104
 - Upgraded Apache to 2.4.54
 - Upgraded Openssl to 1.1.1q
 - Upgraded NetSNMP to version 5.9
 - Upgraded OpenSSH to version 8.9p1
 - Upgraded PHP to version 8.0.20
 - Upgraded GPSD to version 3.23.1
 - Upgraded CakePHP to 4.3.10
- Repaired non-functioning SNMP queries to objects in the UCD-SNMP-MIB file
- Fixed a problem with the SNMPv3 EngineID changing between reboots.
- When halting the unit, the fans are now set to run statically until power is removed.
- Added date information to the Timing menu of the front panel.
- The extension board now has version and upgrade capability. Information on the extension board version can be found on the Upgrade page of the Web UI.
- Added password entry to Open LDAP server configuration.
- Enabled configuration of the alternate timescale displayname for a PTP Power System profile master.
- Added support for querying the Broadshield jamming and spoofing state via SNMP.
- Added the speed over ground measurement to the RMC NMEA message type.
- In order to support vlan network tasks, users are now encouraged to use interface names (eth0, eth1) instead of indexing via CLI commands.
- Added IPv6tables editing to admin accounts.
- Added support for specifying the delay asymmetry between outgoing and incoming paths to counteract timing offsets introduced by the asymmetry.
- Spaces are now accepted characters in all compatible fields for LDAP setup in the Web UI.

The following defects were corrected:

- Fixed a Known Issue with the tcpdump command functionality, which was found to have incorrect ownership, thereby preventing users from deleting files, even with admin rights. (from 1.4.1).
- Fixed a Known Issue: DHCPv6 may not perform as expected. It is recommended to use either static or stateless (SLAAC) IPv6 addressing, particularly with network time distribution (from 1.2.0). The fix limits support to the default DHCPv6 prefix length of 64.
- Fixed the Known Issue: The restore factory defaults function clean does not currently reset the Network Access control rule (from 1.4.1).
- Corrected a defect with duplicate log entries in the oscillator log.
- Fixed an issue wherein usernames were not being carried over by config bundles.
- Corrected an error that prevented deletion of config bundles created through the CLI.
- Added the unit serial number to the manifest log.
- Fixed an issue with timescale adjustments on ASCII references set via the Web UI.
- Added the In Sync message to the Events log.
- Fixed a problem with NTP peers, configured using hostnames instead of IP addresses, not appearing correctly.
- Corrected an error in a chart on the Web UI GSPD Setup page that incorrectly sorted elevation values.
- Corrected the default Receiver Mode to Standard (instead of Mobile).
- Corrected a PTP UTC offset of 0 sent from master to slave.
- Repaired an error in which disabling a master Ethernet port did not end the synchronization of slaves to that port appropriately.
- Fixed the removal of local clocks in the unit configuration via the clearcfg command.
- Removed filtered offset thresholding in PTP to limit reference invalidation and increase fidelity. Network instability is noted in the logs instead of the filtered offset.
- Corrected an incorrect 37 s PTP offset timestamp from master to slave when adjusting the timescale setting.
- Fixed an issue with Ethernet connectivity if the default interface is not enabled
- Repaired upgrade logging functionality to ensure record on non-clean upgrade.
- Removed the possibility of creating a local clock without a name.
- Fixed an error with authentication logs not reaching the remote logging server.
- Fixed a failure of an NTP client to sync to another server.
- Fixed an incorrect 37 s PTP offset seen on the slave after loss of connection to master.
- Corrected an issue with initialization phase of LPN Rubidium oscillators.
- Resolved error on the front panel which only displayed the right fan speed but not the left.
- Fixed a bug which prevented the IP address on the front panel from updating.
- Corrected certain internal communications with SRO-100 oscillators.
- Fixed a memory leak problem with certain front panel screens being active.

Security enhancements and fixes

- Updated SSH functionality to limit weak MAC algorithms.

Option Card enhancements and fixes

- Updated the Extension Board to version 1.07
- Updated the 1204-4A and 1204-49 cards to version 1.2.0
- Updated option card 1204-18 to version 1.03 to correct an error with persistent signals.
- The 1204-3E STL card no longer requires reentry of security credentials for configuration.

Known Issues

- Option cards 1204-49 and 1204-4A are limited to install on slots 1 & 2 only.

- This software version DOES NOT ALLOW downgrades before version 1.4.1.
- ASCII time code format ICD-153c is supported only on the -O2 and -1F option cards, and only if the unit has a SAASM receiver installed. This format is not supported on the main board interface (from 1.3.0).
- The clean command does not reset the GNSS position. It is recommended to unplug the receiver, reset the receiver in the Web UI, and then run the clean command in order to reset the GNSS position (from 1.3.0).
- PTP over a VLAN interface is not currently functional (from 1.4.1).
- PTP Power Profile (IEEE C37.238) is unable to pass the Alternate Time Offset Indicator and Total Time Inaccuracy TLVs through the system when PTP interfaces are configured as both a master and a slave (from 1.4.1).
- The SFP fiber link-state on models AVAGO AFBR-5710PZ and FTLF8519P2BNL are not working properly (from 1.4.1).
- PTP Power Profile (IEEE C37.238) is only able to sync to an EdgeSync master when set to mixed Unicast mode (from 1.4.1).
- Changing the system timescale will require PTP to be manually restarted.

Version 1.4.3

Notes

Units with Hot Swap Power will display a Timing System Hardware Alarm (major) after upgrading to this release if one or more power supplies is disconnected or not functional.

Enhancements and fixes

The following improvements were applied to existing features and functions:

- Fixed a bug occurring on cold boot that provided PTP slaves an incorrect timescale offset.
- Corrected a corrupt database sometimes caused by power removal during boot sequence.
- Fixed an issue with LPN-Rb oscillator units seen occasionally at startup.

Known Issues

- Option cards 1204-49 and 1204-4A are limited to install on slots 1 & 2 only.
- This software version DOES NOT ALLOW downgrades before version 1.4.1.
- ASCII time code format ICD-153c is supported only on the -O2 and -1F option cards, and only if the unit has a SAASM receiver installed. This format is not supported on the main board interface (from 1.3.0).
- The clean command does not reset the GNSS position. It is recommended to unplug the receiver, reset the receiver in the Web UI, and then run the clean command in order to reset the GNSS position (from 1.3.0).
- PTP over a VLAN interface is not currently functional (from 1.4.1).
- The SFP fiber link-state on models AVAGO AFBR-5710PZ and FTLF8519P2BNL are not working properly (from 1.4.1).
- The restore factory defaults function clean does not currently reset the Network Access control rule (from 1.4.1).
- PTP Power Profile (IEEE C37.238) is unable to pass the Alternate Time Offset Indicator and Total Time Inaccuracy TLVs through the system when PTP interfaces are configured as both a master and a slave (from 1.4.1).
- PTP Power Profile (IEEE C37.238) is only able to sync to an EdgeSync master when set to mixed Unicast mode (from 1.4.1).
- The tcpdump command has incorrect ownership, blocking all users from deleting files. To remove files, the user can update to the same or a newer version. To prevent this scenario, you can execute tcpdump as sudo tcpdump -Z <user> ..., (for example: sudo tcpdump -Z spadmin -i eth0 -w file.pcap). This will cause the captured file to be created with ownership of the specified user, allowing said user to delete (from 1.4.1).
- DHCPv6 may not perform as expected. It is recommended to use either static or stateless (SLAAC) IPv6 addressing, particularly with network time distribution.

Version 1.4.1

Notes

- CAUTION: The 1.4.1 software does not allow downgrading. After applying this upgrade bundle, the unit cannot switch to an earlier version of the software without being returned to Orolia for reprogramming.
- This software version will upgrade BOTH system partitions to version 1.4.1 in order to solidify significant system changes. Future standard upgrade files will only upgrade one partition at a time.
- Some upgrade scenarios may cause a loss of user settings. See the Known Issue Upgrade warnings for loss of or altered configurations for more information.
- Units with Hot Swap Power will display a Timing System Hardware Alarm (major) after upgrading to this release if one or more power supplies is disconnected or not functional.

Newly released features

- Added support for downgrades and software rollback. This feature alters the file formats of the upgrades (from .tar.gz to .squashfs) and has important effects:
 - When upgrading from any earlier software version, you are REQUIRED to first upgrade to version 1.4.1 in order to move to a later version.
 - Users will be able to use the “rollback” feature following this software update; however, the rollback feature will simply switch to the simultaneously installed version of this software extant within the other partition.
 - All subsequent software versions will allow downgrading to this version, but will not allow customers to go below 1.4.1.
- Added support for Linux PTP profiles IEEE C37.238-2017 (power systems profile) and IEC 61850-9-3:2016 (power utility profile).
- Added support for the ED25519 host key algorithm for SSH.
- Added software support for DC fixed and Hot Swap power supply options.

Enhancements and fixes

The following improvements were applied to existing features and functions:

- Added missing journal logging for pin configuration, network settings, and NTP and PTP configuration changes.
- Added statistics database to log bundles.
- The Authentication logging option was added to the Local Logging panel of the Web UI to allow user configuration.
- Improved the performance and stability of network timing.
- Set System Time Message, Daytime Protocol, and Time Protocol settings to default to OFF. Configuration enabling these features will persist through this upgrade.
- Added the ability for the user to reset PTP statistics.
- Improved Web UI behavior for PTP configuration.
- Assigned a Major Hardware alarm (called Timing System Hardware Error) in the event of the Hot Swap Power Supply failure. This alarm will also be triggered if you disconnect or unplug, but do not remove, a power supply sled.
- Implemented the FP_lock and FP_unlock CLI commands to effectively lock and unlock the front panel.
- Added support for updated hardware (version 2) on the 1204-50 card.

The following defects were corrected:

- Fixed the Known Issue: When configured as a slave, the on-unit PTP will sometimes incorrectly remain in a Sync state when the Master has gone out of sync (found in 1.3.0).
- Fixed the Known Issue: The 4A/49 option card user configurations will be lost when performing an upgrade that is not “clean”. The card can be reconfigured and will function, but any new configuration will not persist after a power cycle of the unit. Cleaning the unit configuration (or performing a clean upgrade) will allow new configuration to persist correctly. An applied configuration bundle saved from an earlier software version will encounter the same difficulty (found in 1.3.0).
- Fixed the Known Issue: Any changes to the Logging Configuration (for instance, turning on Local Logging) will not take effect without restarting the unit (found in 1.3.0).
- Fixed the Known Issue: If a user configures the time zone via the front panel, the configuration will be lost after upgrade or config bundles are applied (found in 1.3.0).
- Fixed the Known Issue: The Reference Priority configuration is sometimes not restored properly from configuration bundles and will have to be reconfigured following upgrades or application of a config bundle from pre-1.3.0 software (found in 1.3.0).
- Fixed the Known Issue: When multiple major or minor alarms are present, the front panel LED alarm status light will not activate. All other alarm behavior, including notifications, operates as expected (found in 1.3.0).
- Resolved network timing and communication performance issues with the Belfuse SFP-1GBT-05 in ETH1.
- Limited simultaneous UI selection of QZSS with incompatible GNSS signals in order to prevent cross-correlation.
- Corrected an issue occurring when changing certain network settings that required resetting DHCP to resolve.
- Fixed a Web UI 500 error seen when setting the default network interface for IPv6.
- Fixed a Web UI issue that allowed users to incorrectly set the PPS source field for ASCII inputs delivered through the 15-pin connector.
- Edited Web UI settings to correct outdated branding.
- Repaired an issue with the detection of the General Purpose Output being incorrectly identified as a Square Wave output.
- Corrected a Web UI error providing users with an incorrect “pulse width” field which does not apply to 1PPS and 1PPM Output modes.
- Fixed an issue with the pin matrix failing to reset on a clean upgrade.
- Fixed a rare error with Rubidium oscillators in which the disciplining was incorrect.
- Resolved an omission in the Web UI upgrade log in which upgrade validation failures were not displaying correctly.
- Fixed a problem with the receiver mode reporting incorrectly.
- Corrected a minor issue with ZDA NMEA message type displaying on the front panel when used with ASCII output.
- Repaired Web UI issue not correctly displaying the 1204-4A and 1204-49 cards.
- Repaired a few minor errors occurring in the rare circumstance that the reference table is fully emptied by the user.

Security enhancements and fixes

- Applied small patch to kernel to mitigate the Dirty Pipe vulnerability (CVE-2022-0847).
- Removed support for the SSH DSA algorithm due to insufficient key length. Customers are advised to use RSA or equivalent. (DSA configuration will not be removed upon update or while in use unless the user deletes the configuration).
- Added a console (serial) port connection timeout (60 minutes).
- Enhanced the REST API security by verifying the user’s privilege at expected points in order to limit tampering.

- Limited access to databases without full REST API credentials.
- Fixed an error with HTTPS certificate generation in which the Organization and Organization Unit fields were flipped.

Option Card enhancements and fixes

- Option cards 1204-49 and 1204-4A have been upgraded to version 1.1.2
 - Fixed configuration loss after upgrade.
- Corrected an issue with the 1204-2F Programmable Frequency card reverting to default settings following unit reboot.
- Fixed a problem with the 1204-32 PTP Grandmaster card IP settings being lost on reboot.
- Added a user field for the 1204-3E STL card to enter a time offset to compensate for system or antenna cable delays.

Known Issues

- Option cards 1204-49 and 1204-4A are limited to install on slots 1 & 2 only.
- This software version DOES NOT ALLOW downgrades. If you put this software on your system, and later need to return your unit to a software version that came before version 1.4.1, it will be necessary to return your unit to Orolia for reprogramming (from 1.3.0).
- ASCII time code format ICD-153c is supported only on the -02 and -1F option cards, and only if the unit has a SAASM receiver installed. This format is not supported on the main board interface (from 1.3.0).
- The clean command does not reset the GNSS position. It is recommended to unplug the receiver, reset the receiver in the Web UI, and then run the clean command in order to reset the GNSS position (from 1.3.0).
- PTP over a VLAN interface is not currently functional.
- The SFP fiber link-state on models AVAGO AFBR-5710PZ and FTLF8519P2BNL are not working properly.
- The restore factory defaults function clean does not currently reset the Network Access control rule.
- Upgrade warnings for loss of or altered configurations:
 - On software versions before 1.3.0, SNMP, GPSSD, and LDAP settings are preserved on upgrade but not correctly transferred in configuration bundles. These services will need to be re-enabled following the application of a configuration bundle.
 - On software versions before 1.3.0, certain front panel settings for the Local Clock and the Lock Keyboard function do not persist after upgrade.
 - Upon upgrading to 1.4.1 or applying a configuration bundle from an earlier version, the System Time Message feature will be set to ON, regardless of previous setting. Following a Clean upgrade to 1.4.1, the System Time Message, Daytime Protocol, and Time Protocol features will be configured to OFF (the new default state).
 - If your current software is on 1.1.0a or earlier, a direct upgrade to 1.4.1 will fail unless the clean option is selected. To prevent configuration loss, users are advised to save a configuration bundle, perform a clean upgrade to 1.4.1, and apply the saved config file.
- PTP Power Profile (IEEE C37.238) is unable to pass the Alternate Time Offset Indicator and Total Time Inaccuracy TLVs through the system when PTP interfaces are configured as both a master and a slave.
- PTP Power Profile (IEEE C37.238) is only able to sync to an EdgeSync master when set to mixed Unicast mode.
- The tcpdump command functionality was found to have incorrect ownership, thereby preventing users from deleting files, even with admin rights. To remove these files, the user can update to the same or a newer version. To prevent this scenario, you can execute tcpdump as `sudo tcpdump -Z <user> ...`, (for example: `sudo tcpdump -Z spadmin -i eth0 -w file.pcap`). This will cause the captured file to be created with ownership of the specified user, allowing said user to delete the file.

Version 1.3.0

Notes

- CAUTION: The 1.3.0 software does not allow downgrading. After applying this upgrade bundle, the unit cannot switch to an earlier version of the software without being returned to Orolia for reprogramming.

Newly released features

- Improved the on-unit PTP functionality. PTP now has an updated software subsystem, more PTP profile options, and supports both Slave and Master configurations, Unicast, Multicast, and Hybrid settings, and both IPv4 and IPv6 connections.
- Enabled the use of the High Security HTTPS option to restrict the use of TLSv1.
- Standardized the REST API functionality and the documentation procedure for it. All future major changes to REST API endpoints will be documented in these release notes.

Enhancements and fixes

The following improvements were applied to existing features and functions:

- Upgraded several packages:
 - Updated the Linux kernel to 5.10.19
 - Upgraded Apache to 2.4.46
 - Upgraded NTP to version 4.2.8p15
 - Upgraded Openssl to 1.1.1j
 - Upgraded NetSWP to version 5.8
 - Upgraded OpenSSH to version 8.1p1
 - Upgraded PHP to version 7.4.15
 - Upgraded GPSD to version 3.23

NOTE: this upgrade contains a bug fix for the GPS week rollover issue on 2021-10-23.
- Improved the function of the clearlogs, clearstats, and clean commands in the Web UI.
- Improved the RADIUS, LDAP, and TACACS+ forms in the Web UI.
- Improved the user experience of the configuration page of the GP Output.

The following defects were corrected:

- Fixed the Known Issue: “In version 1.2.2, the 2400 cannot be configured to operate as both a PTP slave and NTP client.”
- Fixed the Known Issue: “When switching PTP configuration between master and slave, occasionally the change will not take effect unless manually disabling/reenabling PTP on that interface.”
- Fixed the Known Issue: “The following option cards are currently limited in use to only slots 1 & 2: 1204-2F, 1204-13, 1204-23, 1204-49, 1204-4A, and 1204-30.” Two option cards (1204-49 and 1204-4A) are still limited to install on slots 1 & 2 only. All other option cards are available for use in any slot.
- Fixed the Known Issue: “STANAG 4430 HVK EXTENDED EDITION 1 is not currently functional.”
- Fixed the Known Issue: “Units with more than four 1204-15 IRIG OUT cards installed at once may experience failures and difficulty with programming the outputs.”
- Improved Galileo configuration to follow ublox receiver recommendations.
- Resolved an error with the gpsreset command
- Corrected an issue with certain services (LDAP, GPSD) that were preserved on an upgrade but not during configuration bundle upload.
- Corrected an error in which the temperature alarm configuration was not properly transferred on upgrade.

- Added a missing timescale selection field in the IRIG Output configuration.
- Corrected the Signature Control functionality in GP Output configurations.
- Added a missing toggle to enable/disable the System Time Message.

Security enhancements and fixes

- Resolved compatibility with DHCP, IPv6, and TACACS+.

Option Card enhancements and fixes

- Option card 1204-4A upgraded to version 1.1.1.
- Option cards 1204-23 now available for use on all slots.
- 1204-32 Gb PTP Master Card had several improvements with the updated version 1.31 firmware
 - fixed inoperability with devices that use non-standard values for the PTP transportSpecific field
 - resolved an issue with PTP packets being broadcast before the unit is fully synchronized
 - changed generation of clockAccuracy parameter to reduce unnecessary transitions between Best Masters
 - fixed configuration of TTL value on PTP multicast announce packets
 - corrected the MAC address in Layer 2 PTP packets.

Known Issues

- Option cards 1204-49 and 1204-4A are still limited to install on slots 1 & 2 only.
- This software version DOES NOT ALLOW downgrades. If you put this software on your system, and later need to return your unit to a software version that came before version 1.3.0, it will be necessary to return your unit to Orolia for reprogramming.
- When configured as a slave, the on-unit PTP will sometimes incorrectly remain in a Sync state when the Master has gone out of sync.
- ASCII time code format ICD-153c is supported only on the -02 and -1F option cards, and only if the unit has a SAASM receiver installed. This format is not supported on the main board interface.
- The 4A/49 option card user configurations will be lost when performing an upgrade that is not “clean”. The card can be reconfigured and will function, but any new configuration will not persist after a power cycle of the unit. Cleaning the unit configuration (or performing a clean upgrade) will allow new configuration to persist correctly. An applied configuration bundle saved from an earlier software version will encounter the same difficulty.
- The clean command does not reset the GNSS position. It is recommended to unplug the receiver, reset the receiver in the Web UI, and then run the clean command in order to reset the GNSS position.
- Any changes to the Logging Configuration (for instance, turning on Local Logging) will not take effect without restarting the unit.
- If a user configures the time zone via the front panel, the configuration will be lost after upgrade or config bundles are applied.
- The Reference Priority configuration is sometimes not restored properly from configuration bundles and will have to be reconfigured following upgrades or application of a config bundle from pre-1.3.0 software.
- When multiple major or minor alarms are present, the front panel LED alarm status light will not activate. All other alarm behavior, including notifications, operates as expected.

Version 1.2.2

Enhancements and fixes

The following defects were corrected:

- Fixed a one second offset found in PTP synchronization between the master and slave.
- Corrected an issue with PTP slaves incorrectly reporting as in-sync despite no longer receiving messages from the master.
- Corrected an issue with PTP slaves incorrectly reporting as in-sync despite the designated master no longer being in sync.

Known Issues

- In version 1.2.2, the 2400 cannot be configured to operate as both a PTP slave and NTP client.
- When switching PTP configuration between master and slave, occasionally the change will not take effect unless manually disabling/reenabling PTP on that interface.

Version 1.2.1

Enhancements and fixes

The following defects were corrected:

- Fixed an issue with a memory leak when specific pages were viewed on the front panel. This includes pages viewed that timed out while open. This leak can be found in all previous software versions and is automatically cleared upon a reboot, including when updating to software version 1.2.1.

Known Issues

- The following option cards are currently limited in use to only slots 1 & 2: 1204-2F, 1204-13, 1204-23, 1204-49, 1204-4A, and 1204-30.
- On units that have manually-set time as a PTP Master and then are switched to using a valid reference, the Slave time does not correctly switch to the reference but will instead stay on manual time. If switching between manually-set time and an external reference, the PTP master must be restarted for the slaves to properly follow the new time source.
- When restoring configurations, the GNSS Constellations configuration is on rare occasions not loading correctly.

Version 1.2.0

Amendment issued on 2021/11/4: Thermal control of the cooling fans was added in this release.

Newly released features

- Updated front panel appearance and functionality to add visual indications of reboot, upgrade, and halt states, am/pm indicator light, front panel keypad lock, fan state, and to allow users to configure the time zone of seven segment display.
- Added support for the Hotswap Power Supply feature in the Web UI and on the front panel.
- VLAN is now supported.
- Implemented support for IPv6, including PTP, front panel, and Web UI support
- Enabled support of the SAASM GPS system via option card 1204-50.
- Added support for NTP over Anycast.
- Added GPSD support on units with commercial receivers

Enhancements and fixes

The following improvements were added:

- Added static routes by interface into the Web UI
- Added an option to broadcast PTP timestamps in UTC rather than TAI with an added offset.
- Added enhanced support when the unit is configured as an NTP client to allow close disciplining of the oscillator.
- Enabled TACACS+ usernames and passwords to allow the “_” character
- Improved KTS host disciplining
- Upgraded the Linux kernel to version 4.19.120.
- Improved SFP functionality and reliability
- Removed faulty downgrade paths to earlier, non-standard versions. It will not be possible to downgrade past 1.2.0 from this point forward.
- Changed SNMP monitoring output messages in order to match the SecureSync 1200 functionality to accommodate customers with both systems.
- Allowed users to select SNMP port

The following defects were corrected:

- Fixed an issue wherein the NTP and PTP references were incorrectly handled through the Reference Monitoring chart in the Web UI.
- Corrected 1PPS and 10 MHz alignment
- Fixed a problem with errors on IRIG Outputs.
- Repaired routing to allow destination-based addressing
- Repaired an issue with the GNSS config file sometimes not saving correctly
- Fixed an error with phase validation reference monitoring.
- Resolved a problem occurring when manually set time was removed but the system did not resync to correct references.
- Fixed an issue with the command clearlogs causing a break in the NTP stats recording process
- Corrected a defect with log rotation functionality that caused potential storage problems.
- The net4 command now no longer returns Interface not Activated
- Repaired MTU settings changes in the Web UI
- Fixed a problem in which the listed event times in the Web UI were incorrectly displayed.

Security enhancements and fixes

- Addressed CSRF vulnerabilities related to POST/GET Restful functions

- Removed FTP support to allow for greater security (via SFTP)

Option Card enhancements and fixes

- Added support for option cards 1204-0A, -0F, -03, -09, -1F, -14, -40, -41, -42, -49, -50.
- Upgraded firmware version on the following option card:
 - 1204-4A and 1204-49 cards to version 1.1.0.
 - Released version 1.31 for option card 1204-32
 - 1204-10 upgraded to 1.03
 - 1204-14 upgraded to 1.02
 - 1204-15 upgraded to 1.12
 - 1204-1B upgraded to 1.04
 - 1204-1E upgraded to 1.03
 - 1204-22 upgraded to 1.03
 - 1204-28 upgraded to 1.02
 - 1204-34 upgraded to 1.01
 - Added a field in the Web UI to allow the addition of an offset value to the output of the 1204-02 card

The following defects were corrected:

- Corrected a known issue in which the 1204-4A card configuration was not properly transferred through the config bundle.

Known Issues

- Units with more than four 1204-15 IRIG OUT cards installed at once may experience failures and difficulty with programming the outputs.
- STANAG 4430 HVK EXTENDED EDITION 1 is not currently functional.
- An issue exists with DHCPv6 not setting up valid subnet routes.

Version 1.1.0a

Enhancements and fixes

The following improvements were added:

- Added support for the Interference Detection & Mitigation Suite
- Added support for the 4A option card.
- Enabled PTP on both Ethernet ports.
- Created High Security HTTPS option
- Added LED blinking support for the front panel menu buttons to provide status indicators
- Implemented TACACS+, RADIUS, and LDAP security functionality.
- Inserted the latest version of the pdf User Manual directly to the Web UI.
- Improved clarity over GNSS selection combinations.
- Increased the size of the reference table beyond 16 entries.
- Added the clearcfg command to clear configurations but retain log information.

The following defects were corrected:

- Fixed an issue wherein the NTP status page did not display client throughput.
- Repaired a problem with ASCII Input Time validity in the GGA format.
- Corrected front panel problems: a difficulty displaying leap seconds, a problem halting and clearing configurations, an issue with disabling output through the front panel, a problem with the display of the IP address, and added a front panel test menu.
- Fixed a few minor Web UI errors involving display of option cards
- Repaired a few CLI command issues with the clean command, between IPv4 and IPv6 commands, portset/ portget, and gw4set/ gw6set. Confirmed consistency of CLI commands and underlying network configuration functions.

Security enhancements and fixes

- Added Web UI security features to prevent login simultaneously from multiple locations and mitigate brute force password attacks.

Version 1.0.2

Enhancements and fixes

The following defects were corrected:

- Fixed an issue with Rubidium units skipping the warmup fix.


Security enhancements and fixes

- No major vulnerabilities are currently known or repaired in this release.

Which SW version is installed on my SecureSync?

To determine the software version currently installed on your unit:

1. Login to the unit's Web UI
2. Navigate to Tools > Upgrade/Backup. The System Configuration panel in center of the screen displays the current version number under System:

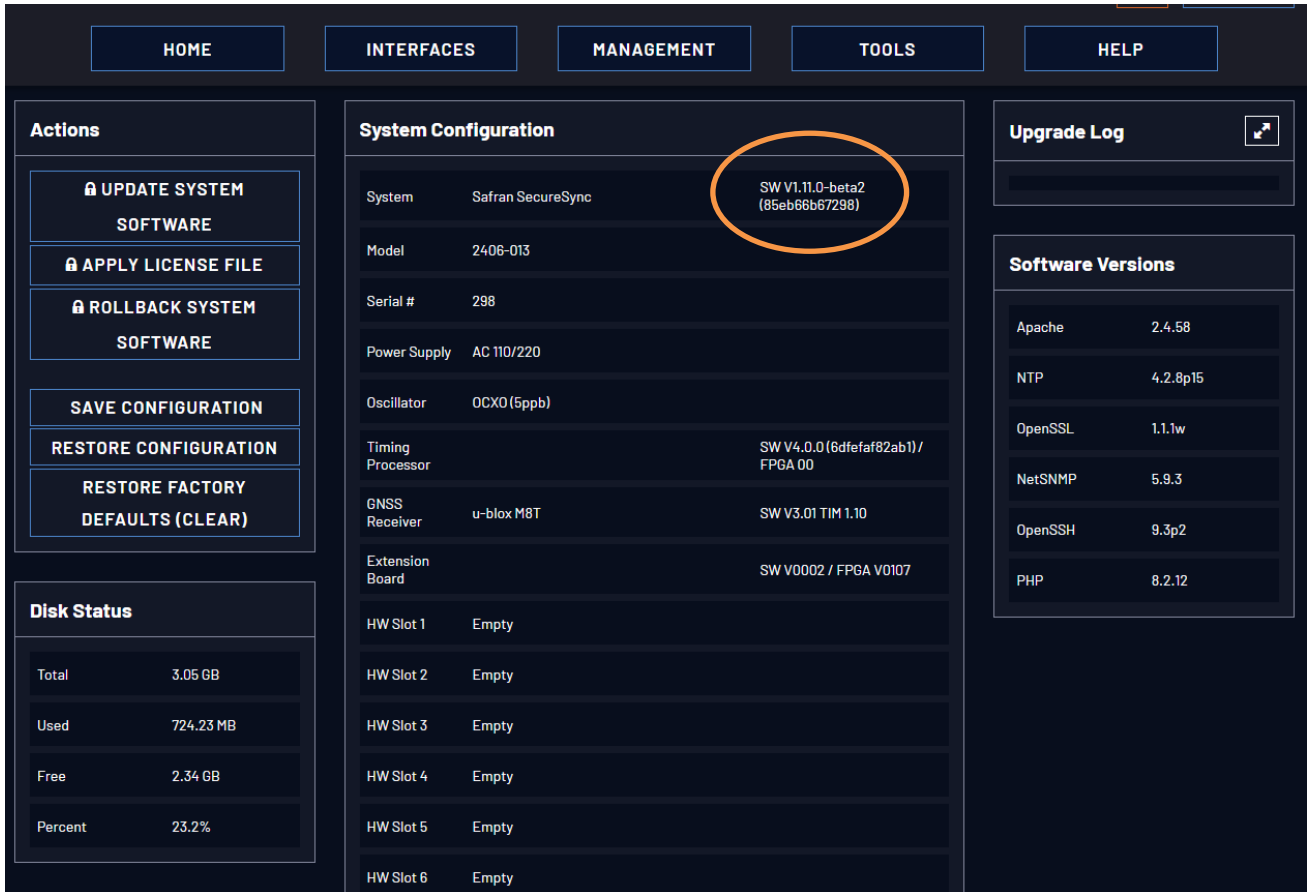

The screenshot displays the SecureSync Web UI interface. At the top, there are navigation tabs: HOME, INTERFACES, MANAGEMENT, TOOLS, and HELP. The main content area is divided into three columns. The left column contains 'Actions' and 'Disk Status' sections. The middle column is titled 'System Configuration' and lists various hardware and software details. The right column contains 'Upgrade Log' and 'Software Versions' sections. In the 'System Configuration' table, the 'System' row shows 'Safran SecureSync' and 'SW V1.11.0-beta2 (85eb88b67298)', which is circled in orange. The 'Software Versions' table lists various system components and their versions.

System Configuration	
System	Safran SecureSync
Model	2406-013
Serial #	298
Power Supply	AC 110/220
Oscillator	OCX0 (5ppb)
Timing Processor	SW V4.0.0 (8dfefaf82ab1) / FPGA 00
GNSS Receiver	u-blox M8T
Extension Board	SW V0002 / FPGA V0107
HW Slot 1	Empty
HW Slot 2	Empty
HW Slot 3	Empty
HW Slot 4	Empty
HW Slot 5	Empty
HW Slot 6	Empty

Software Versions	
Apache	2.4.58
NTP	4.2.8p15
OpenSSL	1.1.1w
NetSNMP	5.9.3
OpenSSH	9.3p2
PHP	8.2.12

Figure 1: Software revision reported under Tools > Upgrade/Backup.

How to download and install the new SW

Installing the Software Update

To upgrade the software installed on your unit, download the latest version from the Safran website:
<https://safran-navigation-timing.com/portal/public-downloads/latest-securesync-2400-update-files/>

Log on to the Web UI and navigate to **Tools > Upgrade/Backup** and click on **Update System Software** in the Actions panel.

Click the **Choose File** button and select the upgrade file location; click Upload.

Click the Perform Upgrade checkbox. If desired, select the Clean Upgrade checkbox as well.

Click on the **Submit** button. The upgrade will begin immediately. The unit will reboot during this process; it will be necessary to begin a new Web UI session.

For more information on this process or any other feature or function of the SecureSync 2400, refer to the main user manual at <https://safran-navigation-timing.com/manuals/>

How to contact Safran Technical Support

Should you have any questions or comments regarding any of the above-mentioned features or fixes, please contact Technical Support:

<https://safran-navigation-timing.com/support-hub/>

Information furnished by Safran is believed to be accurate and reliable. However, no responsibility is assumed by Safran for its use, nor for any infringements of patents or other rights of third parties that may result from its use. Safran reserves the right to make changes without further notice to any products herein. Safran makes no warranty, representation or guarantee regarding the suitability of its products for any particular purpose, nor does Safran assume any liability arising out of the application or use of any product or circuit, and specifically disclaims any and all liability, including without limitation consequential or incidental damages. No license is granted by implication or otherwise under any patent or patent rights of Safran. Trademarks and registered trademarks are the property of their respective owners. Safran products are not intended for any application in which the failure of the Safran product could create a situation where personal injury or death may occur. Should Buyer purchase or use Safran products for any such unintended or unauthorized application, Buyer shall indemnify and hold Safran and its officers, employees, subsidiaries, affiliates, and distributors harmless against all claims, costs, damages, and expenses, and reasonable legal fees arising out of, directly or indirectly, any claim of personal injury or death associated with such unintended or unauthorized use, even if such claim alleges that Safran was negligent regarding the design or manufacture of the part.

Safran Electronics & Defense

- End of document -